

SERVICE BULLETIN

S. B. No. M20-214
Date: 4-18-79

This Service Bulletin is FAA Approved.

SUBJECT: INSTALLATION OF McCAULEY PROPELLER MODEL
B2D34C214/90DHB-16E ON M20J AIRCRAFT ORIGINALLY
EQUIPPED WITH McCAULEY PROPELLER MODEL
B2D34C212/78CDA-4

**MODEL & S/N
AFFECTED:** M20J S/N 24-0001 thru 24-0377

COMPLIANCE: At owner's discretion.

INTRODUCTION: The B2D34C214/90DHB-16E propeller is the spares
replacement for the B2D34C212/78CDA-4 propeller.

INSTRUCTIONS: To install the B2D34C214/90DHB-16E propeller
on aircraft originally equipped with the
B2D34C212/78CDA-4 propeller the following
changes must be made:

1. Install B2D34C214/90DHB-16E propeller in accordance with McCauley decal A2230 (located on propeller hub). Safety wire nuts in pairs.
2. Replace placard P/N 150080-301 which reads "Avoid continuous operation between 1600 and 1950 RPM with power settings below 15" Hg manifold pressure" with placard (P/N 150080-415) which reads "Avoid continuous operation between 1500 and 1950 RPM with power settings below 15" manifold pressure."
3. Re-mark yellow arc on tachometer to extend from 1500 RPM to 1950 RPM.
4. Install new Owner's Manual pages per enclosed revision.
5. Make appropriate log book entry.

S. B. Kit
M20-214-1

150080-415 Placard	1 ea.
Owner's Manual Revision (Pages 1-3 & 1-4 dated 12-28-78 and 6-9 & 6-10 dated 12-28-78)	1 ea.

S. B. Kit
M20-214-2

150080-415 Placard	1 ea.
Owner's Manual Revision (Pages 1-3 & 1-4 dated 12-28-78 and 6-9 & 6-10 dated 12-28-78)	1 ea.
B2D34C214/90DHB-16E Propeller	1 ea.

B2D34C214